



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D350-636-011
Job Sheet 169228-B



Part No: D350-636-011

Job Qty: 1 ea

Part Name: Skidtube LH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 12/5/17

Job Tracking No:

Due Date: 12/15/17

Created By: Marie Lajeunesse

Type: Stock

Description:

Customer: Heli-Fix Maintenance Inc (CHFIX01)

252 Edouard Drouin St Jerome, QC, J7Y 4X5 Canada ph:(450) 712-3955

Note: DWG REV G SHEETS 1,2,4,8 IPP Rev:I 02.09.25 IPP Rev:J 06-03-23 As per Rev D IPP Rev:K 06-07.13 As per dsi9343 IPP Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM Verf:EC IPP Rev:M 08-04-22 DD verified:EC IPP Rev:N 08-09-23 revF DD verified:ec IPP Rev:O 09-02-06 per PAR09-010 DD verf:EC IPP Rev:P 10.06.22 revise seq110 DD verf:EC IPP Rev:Q 10.10.01 as per IIN revH DDverf:EC IPP REV:R 13.08.27 PER ECN13-594 DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		12/14/17	0.00	0.00	Start Up Skidtubes-1		
110	Skidtubes	1 pcs		12/14/17	0.00	4.55	Skidtubes-4		
120	QC	1 pcs		12/14/17	0.00	0.00	QC10		
130	QC	1 pcs		12/14/17	0.00	0.00	QC5		
140	HandFinish	1 pcs		12/14/17	0.00	0.93	HandFinish1		
150	QC	1 pcs		12/14/17	0.00	0.00	QC7-2		
160	Skidtubes	1 pcs		12/14/17	0.00	4.55	Skidtubes-4		
170	QC	1 pcs		12/14/17	0.00	0.00	QC10		
180	QC	1 pcs		12/14/17	0.00	0.00	QC5		
190	HandFinish	1 pcs		12/14/17	0.00	0.93	HandFinish2		
200	SprayPaint	1 pcs		12/14/17	0.00	0.53	Spray Paint		
210	QC	1 pcs		12/14/17	0.00	0.00	QC14		
230	HandFinish	1 pcs		12/15/17	0.00	0.93	HandFinish4		
240	QC	1 pcs		12/15/17	0.00	0.00	QC5		
250	Packaging	1 pcs		12/15/17	0.00	0.00	Packaging1-3		
260	QC	1 pcs		12/15/17	0.00	0.00	QC4		
265	DC	1 pcs		12/15/17	0.00	0.00	DC		
270	Packaging	1 pcs		12/15/17	0.00	0.00	Packaging3-1		
280	QC21-FG	1 Ea		12/15/17	0.00	0.00	QC21		

Part Op 110 - 1- Pick D2600-3 Bent 2- Deburr FWD and AFT ends, remove bending marks. Scribe batch# inside AFT end per dwg

Descriptions: D2750 3- Drill pilot holes for blade fitting bolt holes using DT8983. Start with 3/16", then open to 0.500" using center drill then ream holes using 0.500" reamer. PIN first side. Repeat process on second side. ***ENSURE PROPER POSITIONING FWD BEND MUST BE FACING UP WHEN DRILLING FIRST SIDE*** Drill pilot holes as per Dwg D2750 sheet 4 (D2750-1 details). Drill using drill Jig DT8150 & DT8863A for 2nd side only DT8863B for first side (detail B) 4- Locate DT8330 off of blade fitting bolt holes and drill pilot holes for blade fitting. Open to 0.500" using hole saw. VERIFY AND RECORD FWD BEND ANGLE. 6-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 open to 0.297". 7-Open up holes of Detail A to 0.297" (total of 2 holes per side) 8-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004
160 - 1-Open up holes using hole saw of Detail C and ground handling to 0.625" (total of 8 holes per side) as per dwg

H7x1x2093605

600

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS			
Part		Dart Aerospace Ltd. 1270 Aberdeen Street Hawkesbury, ON K64 1K7 CANADA TEL: 1 613 632-5200 Email: sales@dartaero.com www.dartaerospace.com S033002 Skidtube LH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp. PART NO: D350-636-011 Original Serial #: S033002 Revision: Operation: Change No: Start up Operation 01/17/18 Job No: 169228-B CHG007	Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	
NCR			Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	
Date :			Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	
			Large Fab ☐	Composite ☐	Supplier ☐		
		QTY Effective :			MRB (QSI042) Approval		
		Disposition			Completed By		
					Lead hand / Supervisor Approval Verification		
					QC / QA Coordinator Approval		
Environm Des Doc/D Equip/Tool Handling/ Mate Internal Transp Tribal Knowlec L Substati		FAULT CATEGORY					
 S033002		☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong			
		☐ Set-up	☐ Folio/Program	☐ Outside Dimensions			
		☐ BOM/Route	☐ Grain	☐ Over/Under tolerance			
		☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect			
		☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing			
		☐ Contamination	☐ Out of Sequence	☐ Part Moved			
		☐ Countersink	☐ Off-set	☐ Drawing			
		☐ Cut Too Short	☐ Misabeled	☐ Finish			
		☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread			
		☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence			
		Past Expiry Date ☐		Manufacturing Process ☐			
		Misidentified ☐		Past Due ☐		OTHER : _____	

D2750. 2-Open up holes using hole saw of Detail B to 0.750" (total of 4 holes per side) 3- Open float hole using un-bit to 0.500" (4 per side) 4-Chamfer holes of Detail B, C, ground handling and float holes per dwg D2750 (welding instructions on sheet 8) 5-Debur and blow out all chips from inside of tube 6- Prepare tube for welding, remove alodine as required. 7-Bond web D2739 in place as per QSI 015, let cure for 12hrs. A/R exp. date: 308-04-31 ***ATTN: USE I-BEAM LOCATION AID (BLADE FITTING)*** 8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004 (welding instructions on sheet 8) A/R 9- At section AJ-AJ drill out x-bolt spacer to 0.404" 10-Grind welds flush as per Dwg D2750 11-Spot face ground handling holes section (total of 4 places per side) as per dwg D2750 12-Debur holes, ensure tube is free of all scratches before sending to paint.

180 - ***VERIFY C'BOARD IS GOOD***

190 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

200 - 1- PRIME AS PER DWG AND QSI 005 4.2

210 - Inspect for foreign object per QSI 024

230 - 1- Install inserts as per Dwg D2750 2-Inspect for Foreign Objects 3- Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D2750 SIKA FLEX 241 BATCH: M138654 EXP DATE: 2018-04-31 4- Assemble o'ring to plug as per dwg D3492 and apply o'ring lube 5- Coat all exposed fasteners with "LPS Procyon" batch: M133690

260 - *****ensure antiseize is on AN8C21A bolts*****

265 - record fwd angle: 89.8° Photocopy blue file and type labels per PPP D350-636-011 CHG 007

270 - Package as per PPP D350-636-011 Location : FG072

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	D2600-3-BENT-LH <u>5030117</u>	1	0	0	0
	D2744 <u>5003318</u>	1	18	0	0
160-Skidtubes	D2739 <u>8165480</u>	1	14	0	0
	D2743 <u>5026588</u>	8	120	0	0
	D3490-1 <u>5017322</u>	4	29	0	0
	D3490-3 <u>5030890</u>	4	17	0	0
230-HandFinish	ALS4-1032-225 <u>5007280</u>	38	1,775	0	0
	AN3C5A <u>5019396</u>	34	280	0	0
	AN3C6A <u>5019397</u>	4	89	0	0
	AN6C44A <u>FA137055-1</u>	4	521	0	0
	AN8C35A <u>FA137203</u>	1	97	0	0
	D2745 <u>5026936</u>	8	88	0	0
	D3488-041 <u>FA163322-4</u>	1	9	0	0
	D3492-1 <u>5025647</u>	8	48	0	0
	D3492-3 <u>5026057</u>	8	89	0	0
	D3535-25 <u>5032628</u>	1	10	0	0
	D3536-25 <u>5031897</u>	1	13	0	0
	D3537-1 <u>5037413</u>	3	71	0	0
	D3631-1 <u>5008168</u>	8	213	0	0
	D3791-1 <u>5024390</u>	1	8	0	0
	D3793-1 <u>5031903</u>	1	8	0	0
	D3793-3 <u>5032647</u>	1	9	0	0
	D3794-1 <u>5031919</u>	1	5	0	0
	D3794-3 <u>5032222</u>	1	8	0	0
	MS21043-6 <u>5016883</u>	4	102	0	0
	MS21083C8 <u>5034401</u>	1	71	0	0
	NAS1149C0332R <u>5019380-1</u>	38	2,502	0	0
	NAS1149C0832R <u>FA138409-121</u>	1	113	0	0
	NAS1515H3L <u>FA137361-25</u>	4	218	0	0
	NAS1611-010 <u>5022098</u>	8	134	0	0
	NAS1611-013 <u>5022099</u>	8	105	0	0
250-Packaging	AN8C21A	2	225	0	0
	D2741	1	40	0	0
	D3493-1	2	32	0	0
	D3532-1	2	5	0	0
	MS21083C8	2	71	0	0
	NAS1149D0863J	2	199	0	0

Part Specifications

Specifications could not be found.

000578

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER

GENERAL NOTES:

- MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- FINISH: ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
STANDARD: PRIME (REF. 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2
OPTIONAL: POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED
- BREAK SHARP EDGES: N/A
- IDENTIFICATION: N/A
- WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- WELD PER DART QSI 004
- INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES (Ø.297) FOR WEARSHOE INSERTS
- FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
FINISH WITH MEK DEGREASER.
- SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 1169228-R MJS
17-12-05

RELEASED
2013-08-13
ND

G	CORRECTED TOLERANCE ON Ø0.500 THRU HOLE: IS +0.010/-0.000. WAS +0.100/-0.000 (ZN B3-4, B2-5); ADD VIEW TO CONTROL FWD BEND ORIENTATION (ZN D-1-4/-5/-6/-7); UPDATED FINISH OPTIONS; INSIDE OF TUBE NO LONGER SPRAYED WITH LPS-3. REASON: PART 13-276 AND NCR13-2757	MB	13.07.11
F	INCORPORATE DSI 8413; QTY (3) D3537-1 WAS QTY (5) (ZN C8-1); D3791-1/-3 REPLACES D3535-13/-35 (ZN C8-1); D3794-1/-3 REPLACES D3536-13/-35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWD/AFT SADDLE REMOVED (8 PL); WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY (38) NAS1515H3L; REMOVE QTY (10) NAS1515H8L; REMOVE D2741, QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DEO 9133/9157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	98.11.18
B	CHANGE MS24694-S293 TO AN8-16A	CP	98.09.01
A	NEW ISSUE	DS	98.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN	MM		
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	13.07.11		

DART AEROSPACE USA, INC.
KENT, WA

DRAWING NO.
D2750
TITLE
350 SKIDTUBE ASSEMBLY
SCALE
NTS

REV. G
SHEET 1 OF 11

COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																														
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																															
Large Fab ☐	Composite ☐	Supplier ☐																																																																
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																														
Description Work Order Deviation		Disposition		Completed By																																																														
				Lead hand / Supervisor Approval Verification																																																														
				QC / QA Coordinator Approval																																																														
<table style="width: 100%; border: none;"> <tr> <td colspan="2" style="text-align: center;">Root Cause</td> <td colspan="3" style="text-align: center;">FAULT CATEGORY</td> </tr> <tr> <td style="width: 15%;">Environment ☐</td> <td style="width: 15%;">No Re-verification ☐</td> <td style="width: 15%;">Pressure/Forced ☐</td> <td style="width: 15%;">Temperature/Cure ☐</td> <td style="width: 15%;">Power Loss/Surge ☐</td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> <td colspan="3" rowspan="2" style="text-align: center; vertical-align: top;">OTHER : ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>					Root Cause		FAULT CATEGORY			Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐			Misidentified ☐	Past Due ☐
Root Cause		FAULT CATEGORY																																																																
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐																																																														
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐																																																														
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐																																																														
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐																																																														
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐																																																														
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐																																																														
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐																																																														
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐																																																														
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐																																																														
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐																																																														
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐																																																																
Misidentified ☐	Past Due ☐																																																																	

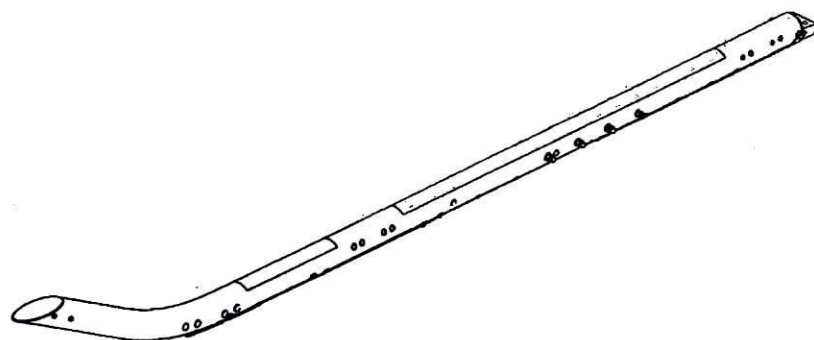

D2750-041 350 SKIDTUBE ASSEMBLY, LH

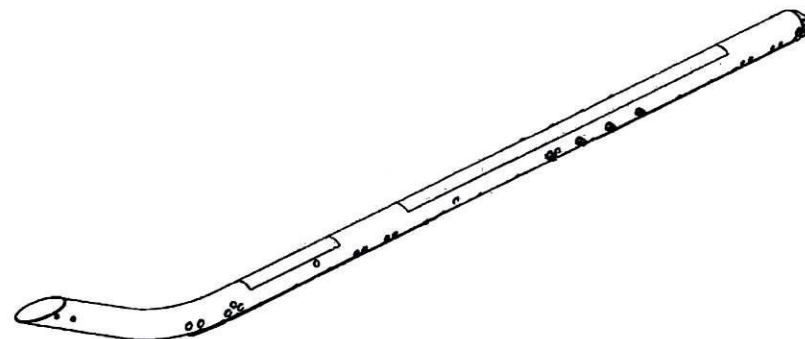

D2750-042 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2013-08-13
ND

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		TITLE	SHEET 2 OF 11
APPROVED		350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	13.07.11	COPYRIGHT © 1999 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS FRAGILE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

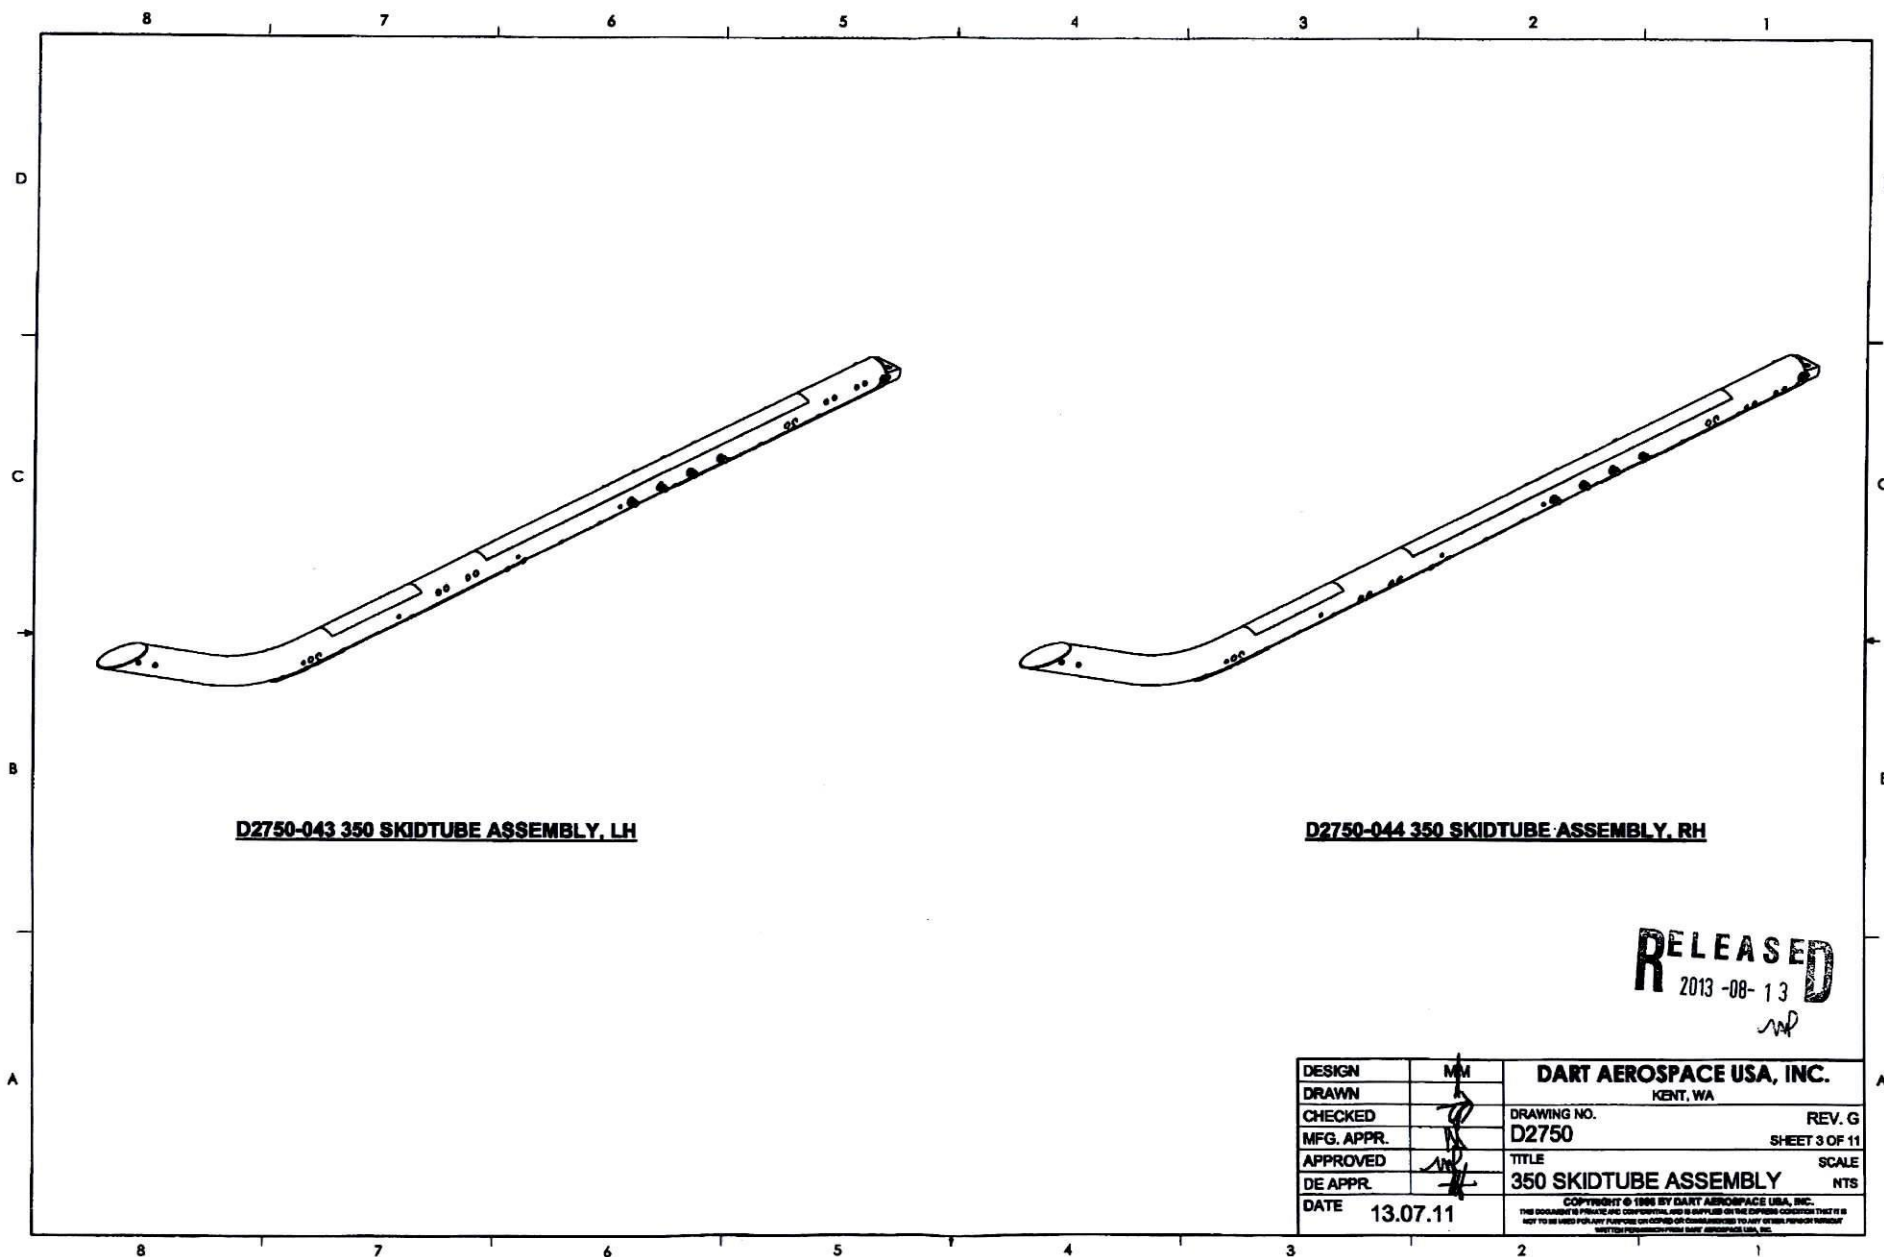

D2750-043 350 SKIDTUBE ASSEMBLY, LH

D2750-044 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2013-08-13
wp

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D2750	REV. G
MFG. APPR.		SHEET 3 OF 11	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1999 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS COVENANT THAT IT IS NOT TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, INCLUDING PHOTOCOPYING, RECORDING, OR BY ANY INFORMATION STORAGE AND RETRIEVAL SYSTEM, WITHOUT PERMISSION IN WRITING FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					


8 7 6 5 4 3 2 1

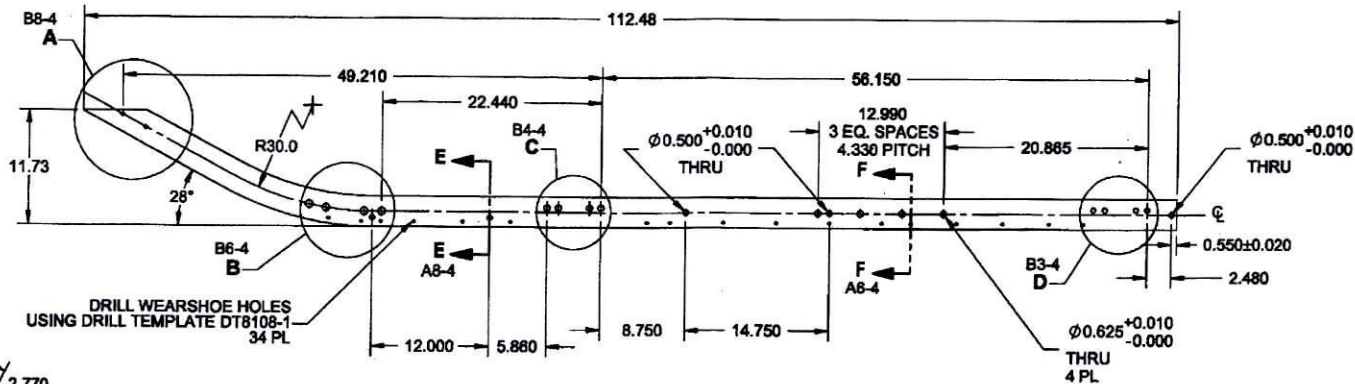


D2750-1 LH SKIDTUBE

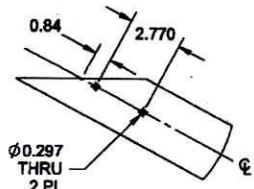


DETAIL A
SCALE 2X

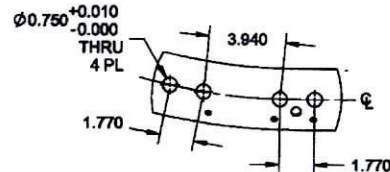


DETAIL B
SCALE 2X

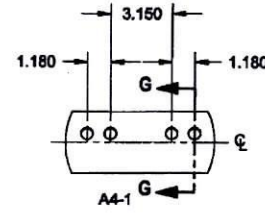


DETAIL C
SCALE 2X

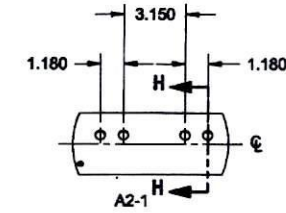


DETAIL D
SCALE 2X

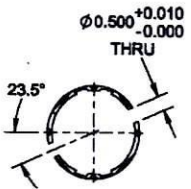


SECTION E-E
SCALE 3X, 2 PL

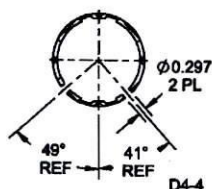

SECTION F-F
SCALE 3X, 17 PL

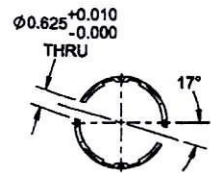

SECTION G-G
SCALE 3X, 4 PL

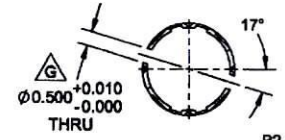

SECTION H-H
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		SHEET 4 OF 11	
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	
DATE	13.07.11	NTS	

COPYRIGHT © 1999 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

8 7 6 5 4 3 2 1

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
				Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
				Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
				Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
				Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
				Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
				Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
				Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
				OTHER : _____			

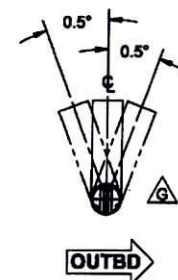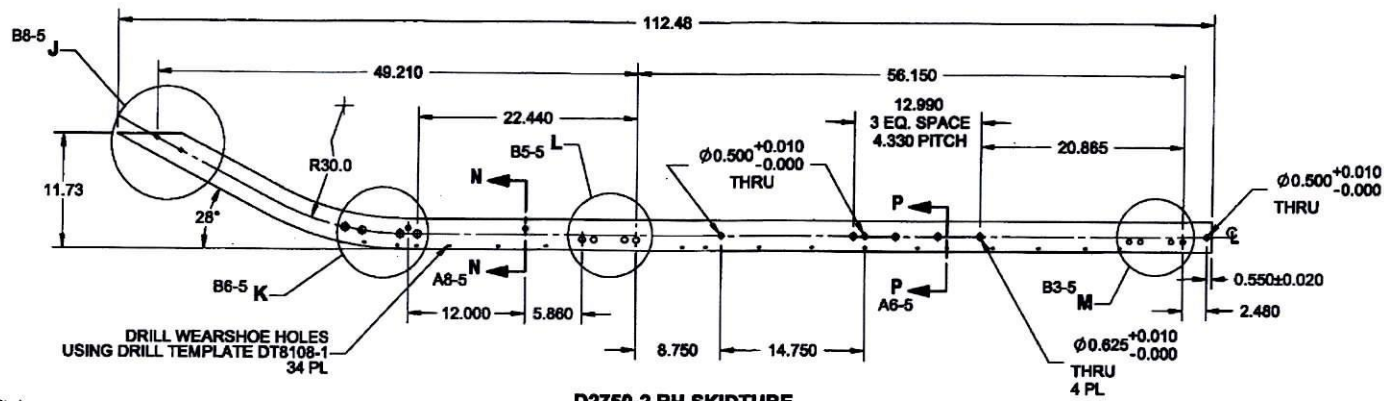


MAX ALLOWABLE
TWIST ON FWD BEND
(VIEWED LOOKING FWD)


D2750-2 RH SKIDTUBE

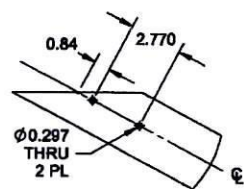


DETAIL J
SCALE 2X

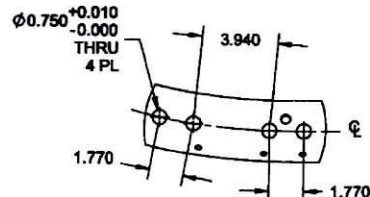


DETAIL K
SCALE 2X

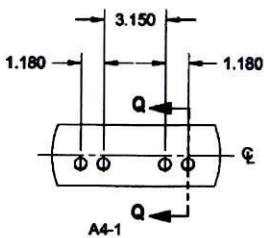


DETAIL L
SCALE 2X

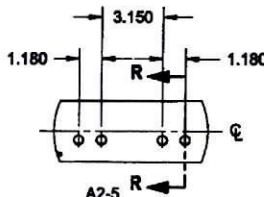


DETAIL M
SCALE 2X

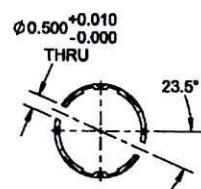


SECTION N-N
SCALE 3X, 2 PL

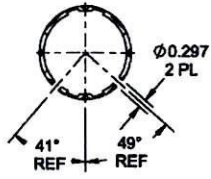

SECTION P-P
SCALE 3X, 17 PL

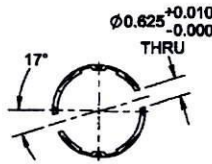

SECTION Q-Q
SCALE 3X, 4 PL

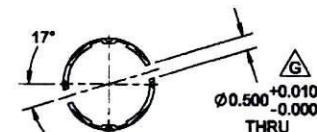

SECTION R-R
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D2750	SHEET 5 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1999 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE OPENING CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					


8 7 6 5 4 3 2 1

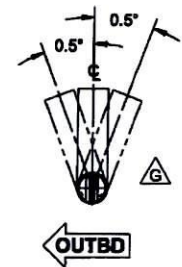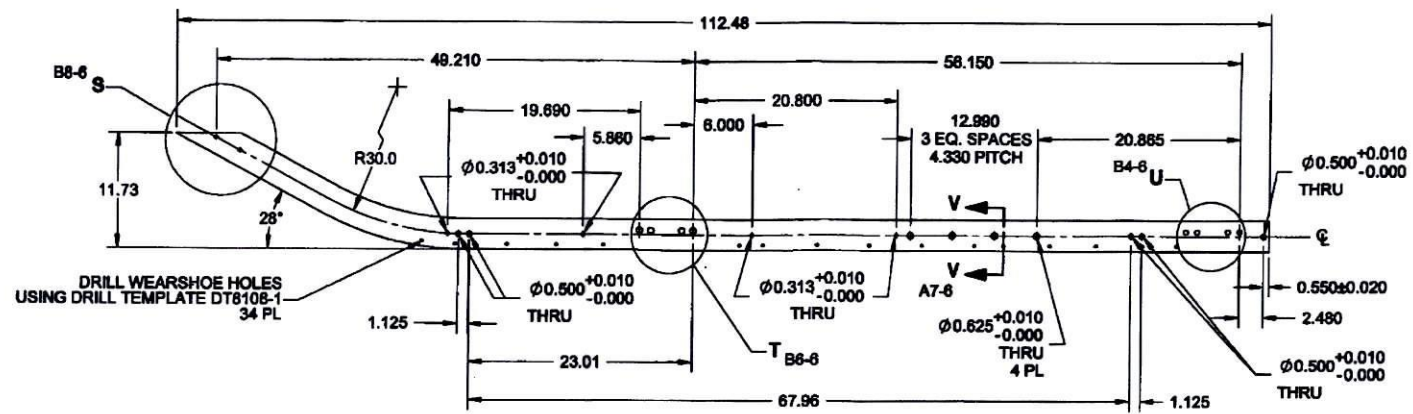


D2750-3 LH SKIDTUBE

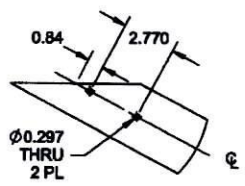


DETAIL S
SCALE 2X

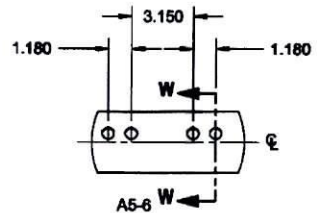


DETAIL T
SCALE 2X

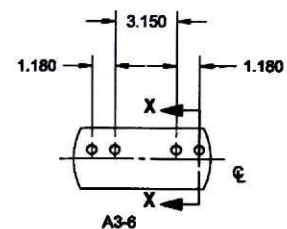


DETAIL U
SCALE 2X

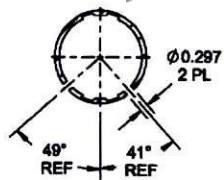

SECTION V-V
SCALE 3X, 17 PL

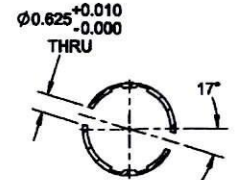

SECTION W-W
SCALE 3X, 4 PL

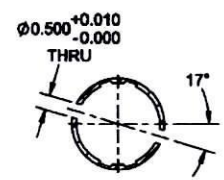

SECTION X-X
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D2750	SHEET 6 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC EXCEPT THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

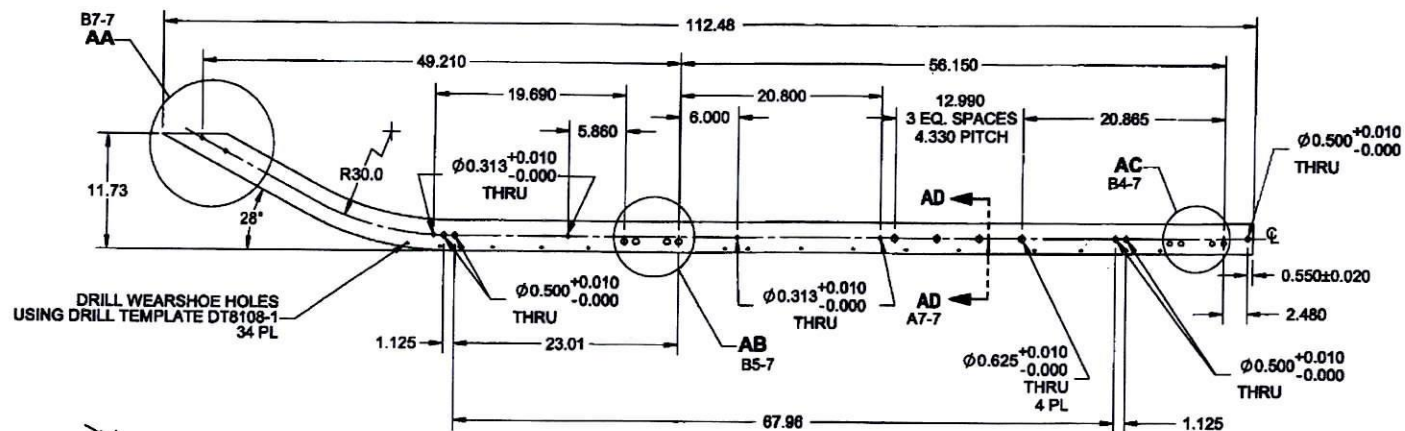


D2750-4 RH SKIDTUBE

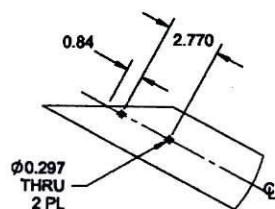


DETAIL AA
SCALE 2X

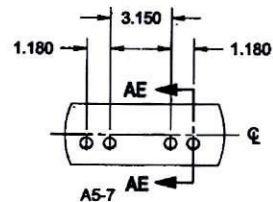


DETAIL AB
SCALE 2X

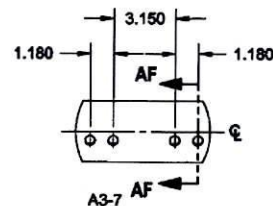


DETAIL AC
SCALE 2X

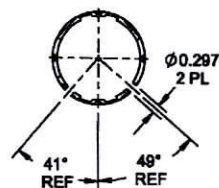

SECTION AD-AD
SCALE 3X, 17 PL

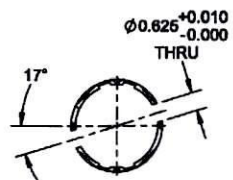

SECTION AE-AE
SCALE 3X, 4 PL

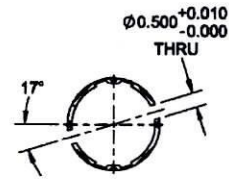

SECTION AF-AF
SCALE 3X, 4 PL

RELEASED
2013-08-13
MP

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D2750	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY				
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : ☐						

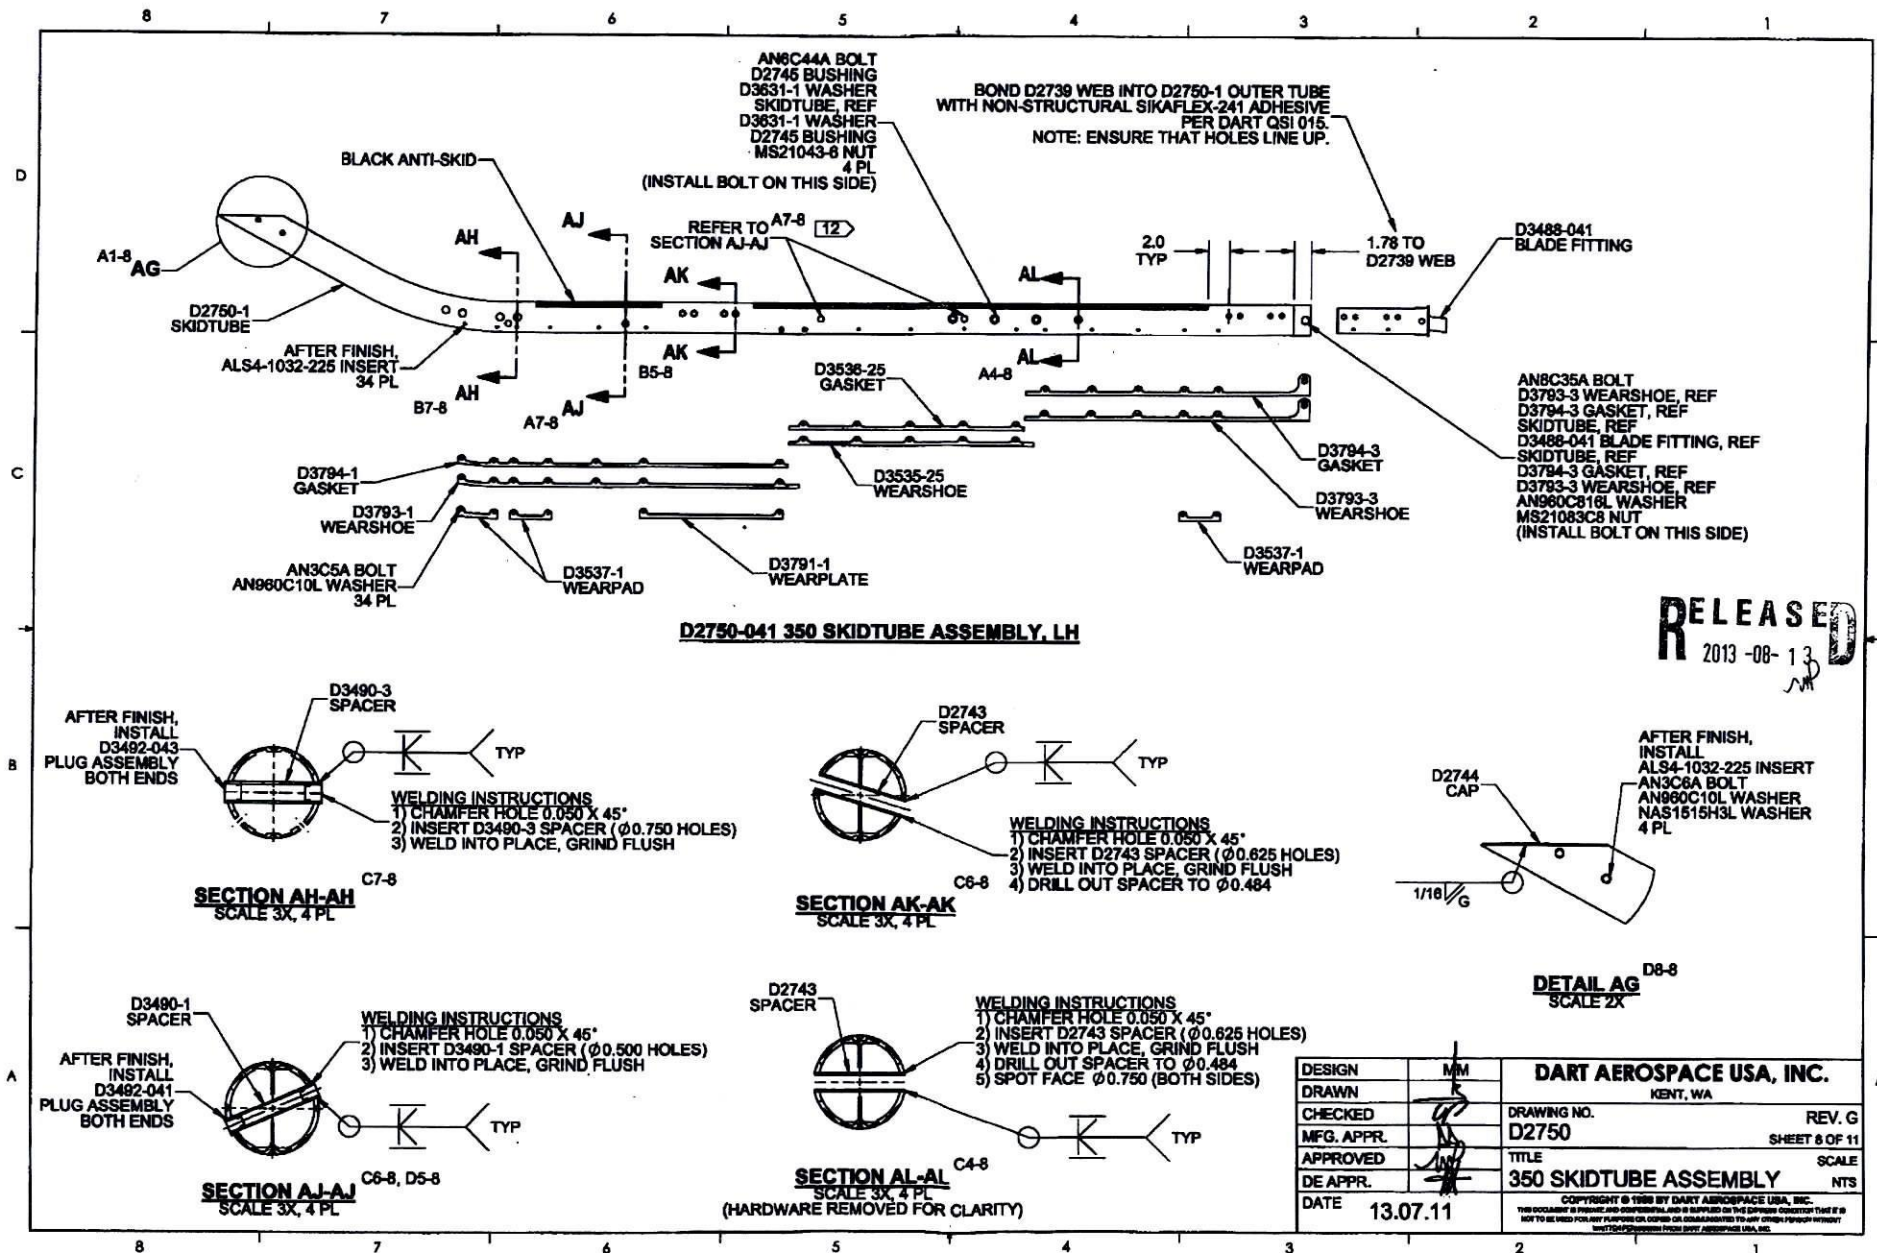

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐				
Misidentified ☐	Past Due ☐	OTHER :			

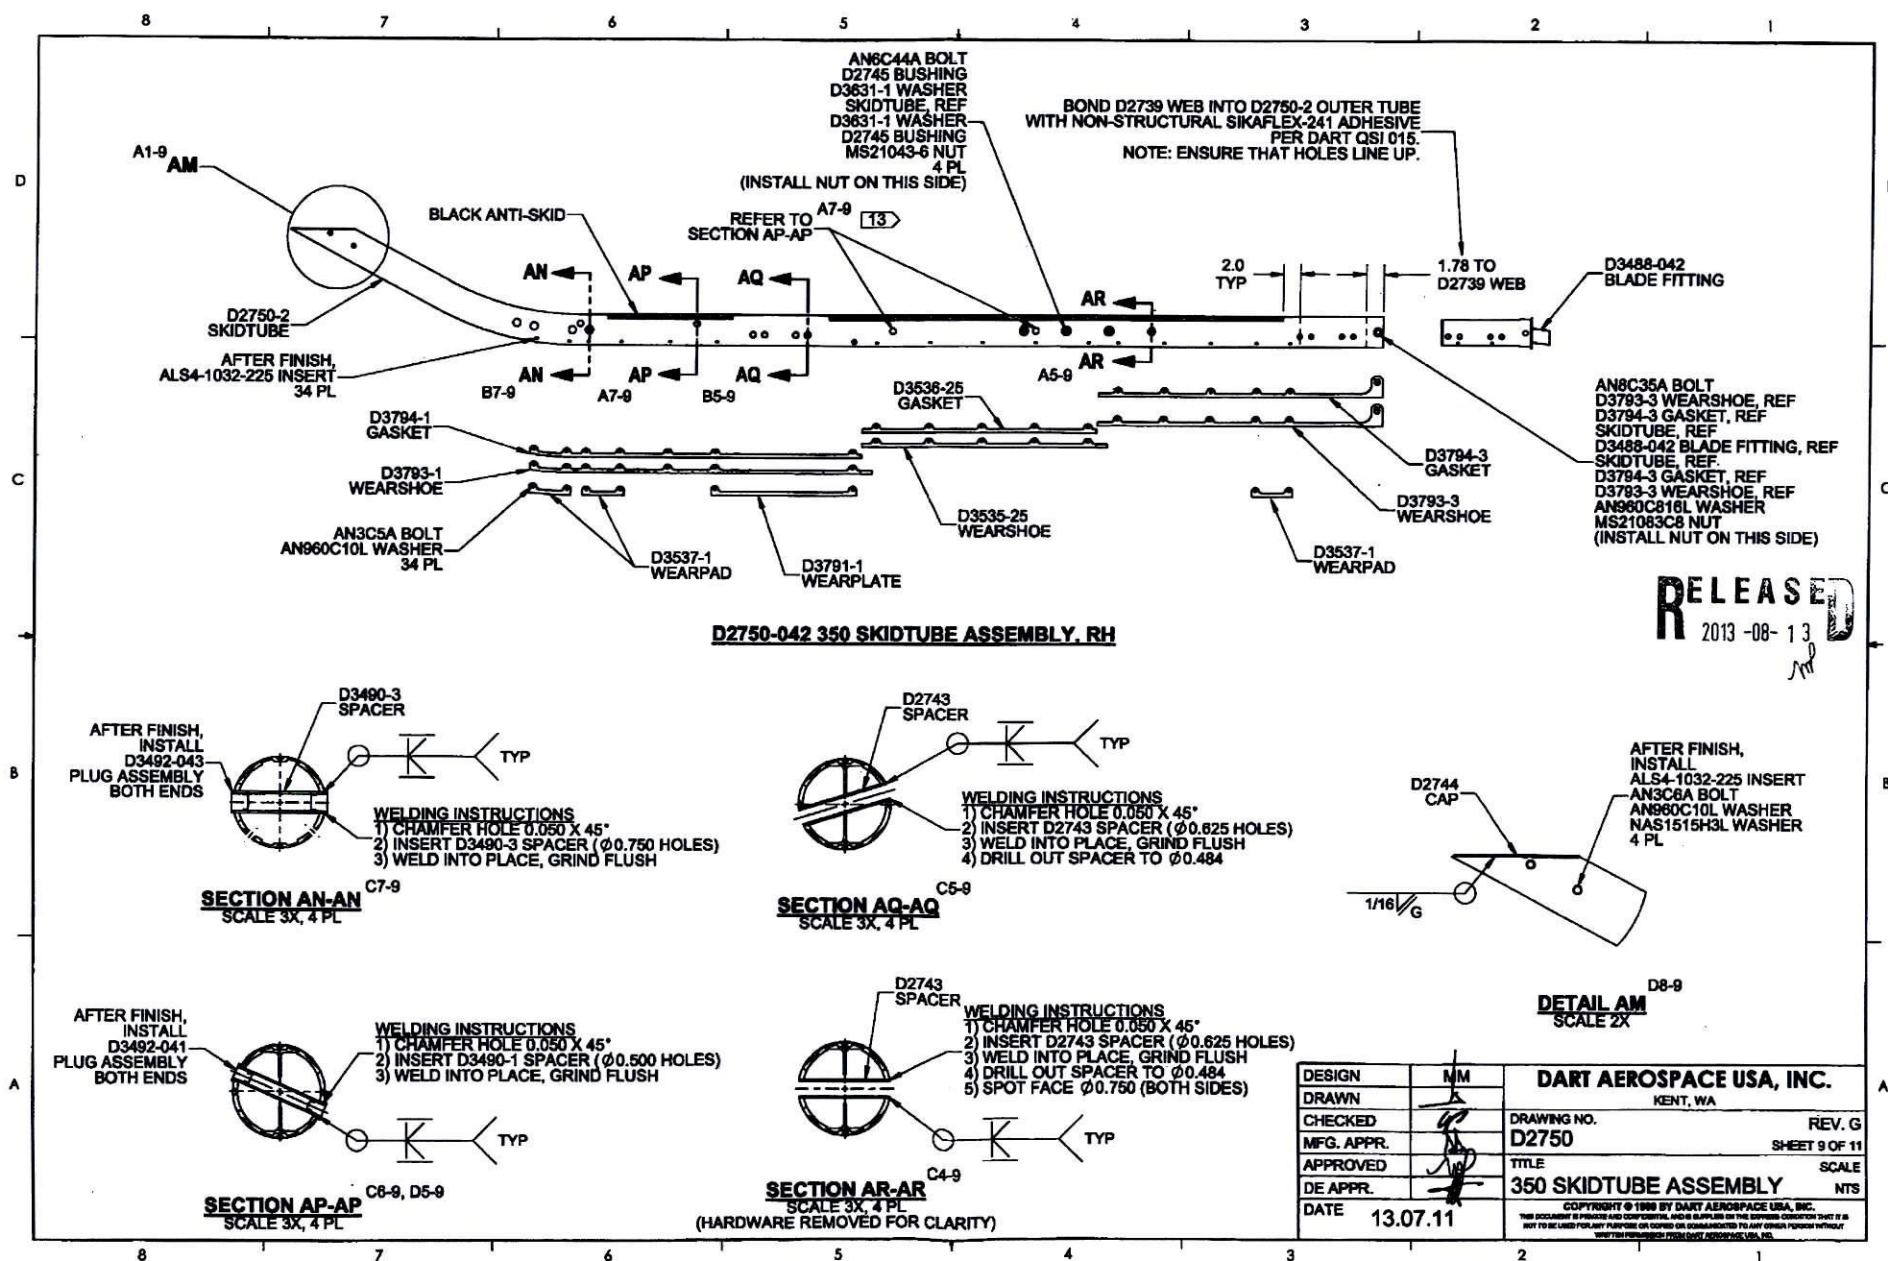

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

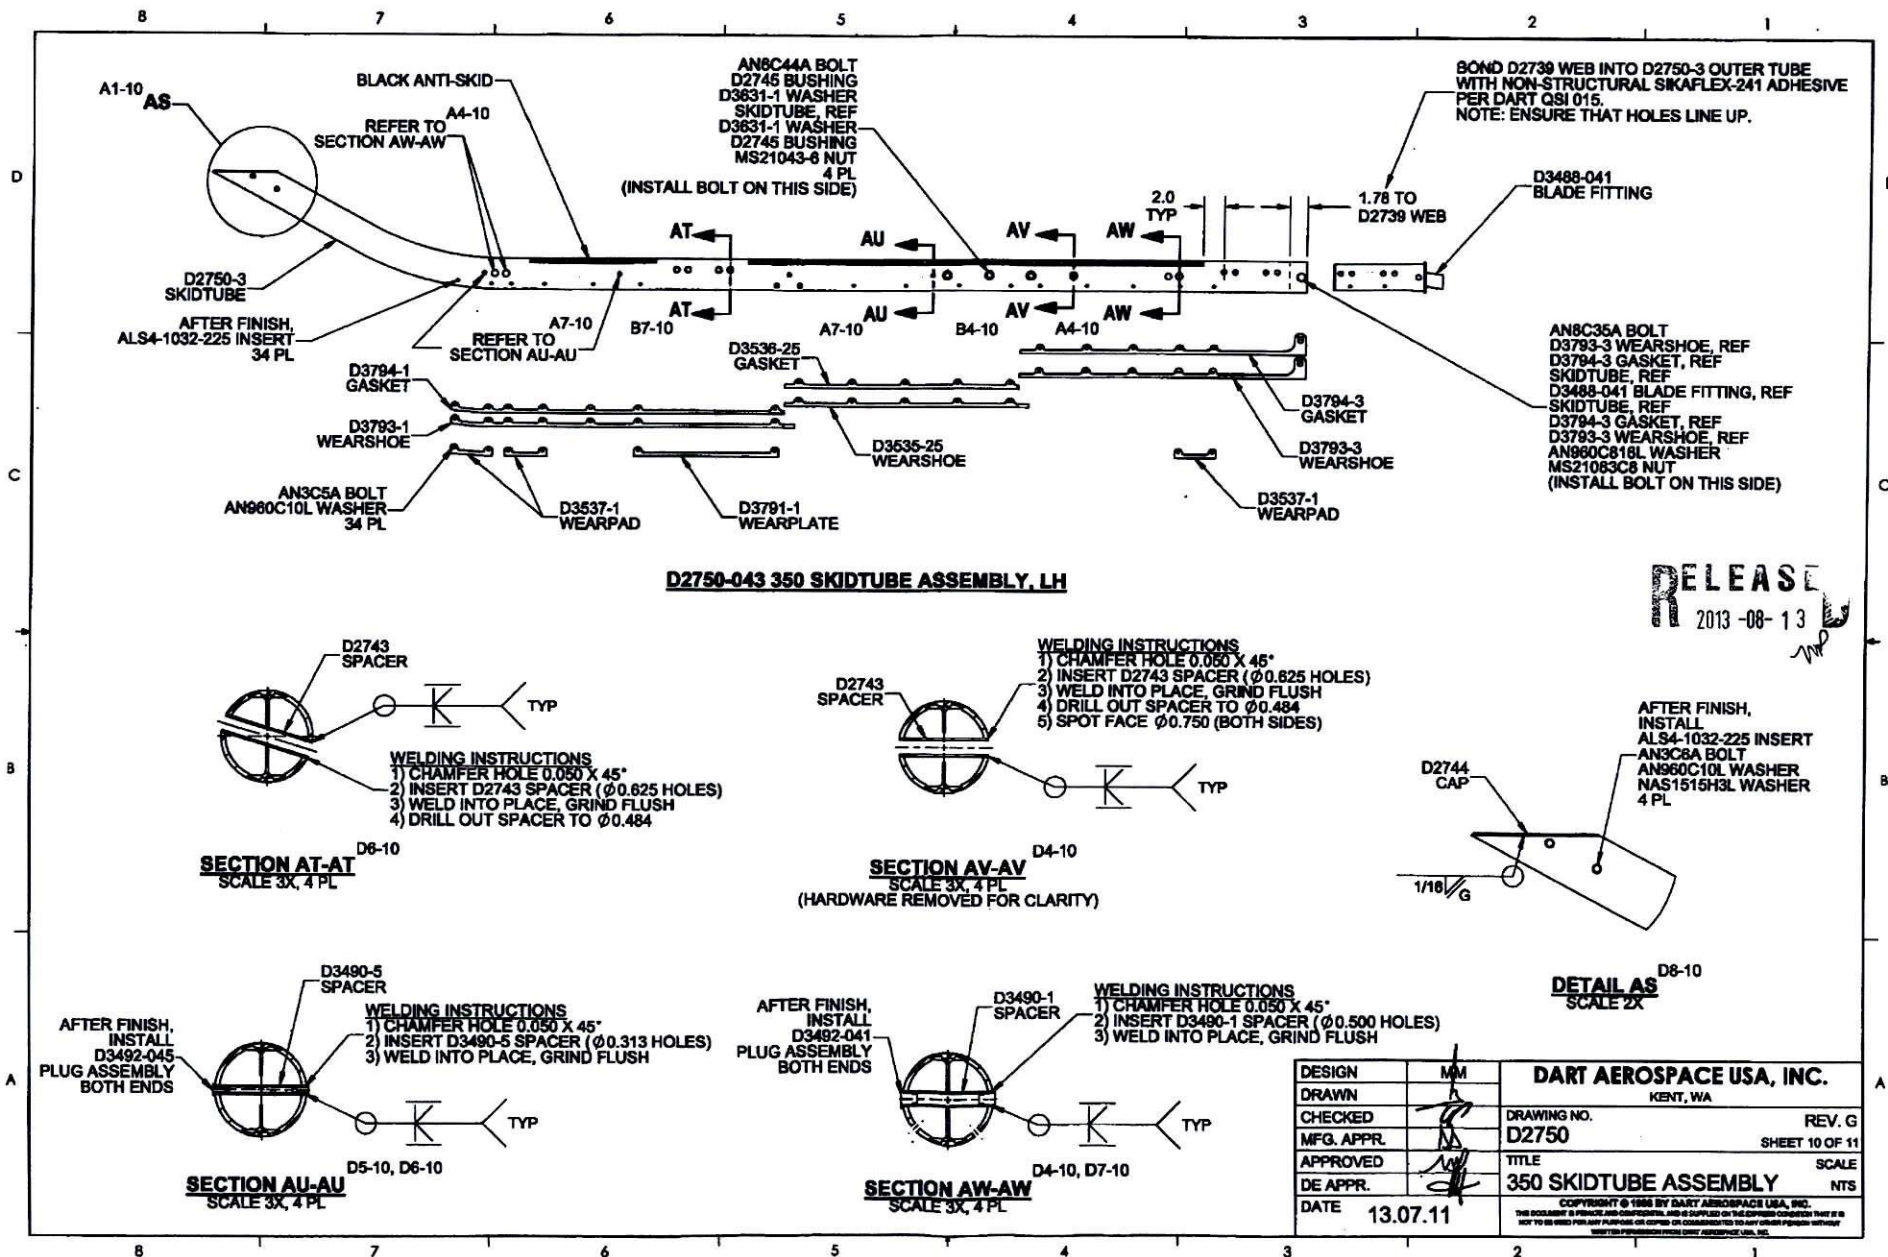

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER :									

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER PO038933

Supplier: ATE003-VC
Atelier Debosselage
358 Principale
Calumet
QC
J0V 1B0 Canada
Phone: 819 242 5633

PO No: PO038933
PO Date: 2/2/18
Due Date: 2/5/18
**Purchase Order
Revision:**
Revision Date:
Ship-To Contact: Baker, Diane
Phone: dbaker@dartaero.com

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

Via: Ground
Pymt Terms: Net 30
Freight Terms:
Special Comments:

Items

Line Item	Job	Part	Description	Status	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	168941	D3391-021	Fwd Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$125.00/pcs	\$125.00
2	168617-A	D3391-021	Fwd Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$125.00/pcs	\$125.00
3	168760-A	D3391-021	Fwd Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs 1X	1 pcs	\$125.00/pcs 18/02/02 mdf	\$125.00
4	168619-B	D3391-023	Mid Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$125.00/pcs	\$125.00
5	168761-A	D3391-023	Mid Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs 1X	1 pcs	\$125.00/pcs 18/02/02 mdf	\$125.00
6	168761	D3391-023	Mid Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$125.00/pcs	\$125.00
7	168621-C	D3391-025	Aft Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$125.00/pcs	\$125.00
8	168621-A	D3391-025	Aft Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$125.00/pcs	\$125.00
9	168621-B	D3391-025	Aft Tube Assembly	Firmed	2/5/18	1 pcs	0 pcs 1X	1 pcs	\$125.00/pcs 18/02/02 mdf	\$125.00
10	169228-B	D350-636-011	Skidtube LH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.	Firmed	2/5/18	1 pcs	0 pcs 1X	1 pcs	\$225.00/pcs AT 18/02/06	\$225.00
11	169228	D350-636-011	Skidtube LH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.	Firmed	2/5/18	1 pcs	0 pcs 1X	1 pcs	\$225.00/pcs 18/02/02 mdf	\$225.00
12	169856	D350-636-011	Skidtube LH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.	Firmed	2/5/18	1 pcs	0 pcs 1X	1 pcs	\$225.00/pcs 18/02/02 mdf	\$225.00
13	167569	D350-636-012	Skidtube RH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
14	167568-A	D350-636-012	Skidtube RH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float	Firmed	2/5/18	1 pcs	0 pcs 1X	1 pcs	\$225.00/pcs AT 18/02/06	\$225.00



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER PO038933

Items

Line Item	Job	Part	Description	Status	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
			Comp.							
✓ 15	167302-B	D350-636-015	Skidtube LH, Run-on Landing Wearplates, DART(Apical) Cylind./Aerazur Float Comp.	Firmed	2/5/18	1 pcs	0 pcs 1x	1 pcs	\$225.00/pcs 18/02/02	\$225.00 ms
16	167302	D350-636-015	Skidtube LH, Run-on Landing Wearplates, DART(Apical) Cylind./Aerazur Float Comp.	Firmed	2/5/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
✓ 17	167339	D350-636-016	Skidtube RH, Run-on Landing Wearplates, DART(Apical) Cylind./Aerazur Float Comp.	Firmed	2/5/18	1 pcs	0 pcs 1x	1 pcs	\$225.00/pcs 18/02/02	\$225.00 ms
Grand Total:									\$2,925.00	

Order Notes

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 2/2/18 10:21 AM dart.baker.diane



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Master Unit 000578

Tel (613) 632-5200

Containers on Master Unit 000578				
Serial No	Part No	Customer Part No	Status	Quantity
S039821	D2741	D2741	Allocated	1
S039819	D3493-1		Allocated	2
S039817	D3532-1		Allocated	2
S024441	MS21083C8	MS21083C8	Allocated	2
S039816	NAS1149D0863J	NAS1149D0863J	Allocated	2